



TECHNICAL DATA

2705 CONCORD ROAD • BELLE CHASSE, LA 70037
PHONE 504 / 392-8811 • FAX 504 / 392-2173 • www.royalcoatings.net

DETAILED INSTRUCTIONS FOR APPLYING VOID KOTE

- 1). Remove all loose material, grease, welding flux, etc.
- 2). Surface should be clean. Pressure wash if necessary.
- 3). Surface should be dry. Slight condensation is acceptable.
- 4). Mechanically agitate **VOID KOTE** for two minutes to uniformly stir the solids. **Do not add any water or thinner.**
- 5). Apply with an airless spray gun of 30:1 or better using a 23 - 25 tip. Apply to a wet film thickness of 8 - 10 mils.
- 6). Ventilate the tank for 12 - 24 hours to ensure that it is dry through to the substrate. **Ambient conditions below 43°F may require longer ventilation or the use of warm air.** The use of inline heaters assists in curing the coating in cold weather.
- 7). To prevent **VOID KOTE** from adhering to skin or boots during application coat with vaseline, baby oil or equivalent.
- 8). For best results store **VOID KOTE @ 50° F** or higher.

07/09